

# SAFETY TECHNOLOGIES NEWS



June 29<sup>th</sup>, 2023

Dear Customer,

**WARNING! All recipients of this Product Market Action Notice must read, understand and follow all instructions carefully.**

While there have been no reported incidents due to this safety issue, **Honeywell Personal Protective Equipment has issued this Product Market Action Notice because the improper use of the product in the affected SKUs may result in serious injury or death.**

It is not possible to check the physical stitching without tempering the protective case of the shock absorber, hence we advise below non-destructive inspection method to check on the stitches.

The following information provides detailed instructions on immediate actions you are required to take:

- **These products must be immediately separate from work area/ field/ stock**
- These products must be checked before use as per Instruction below.

Inspection instruction:

1. By using a pen or a small cylindrical rod, insert into the shock absorber protective pack. Please do not use any item that has sharp or pointing edges, to prevent damage to the shock absorber (Picture 1 and Picture 2)
2. Create a cavity and remove the pen or cylindrical rod, check if there is presence of stitching inside the absorber (Flashlight would be helpful if the surrounding is dark) (Picture 3)
3. If found that the stitching is missing at the shock absorbing pack, please notify us to initiate RMA process



Picture 1



Picture 2



Picture 3

Additional instructions for Honeywell partners/distributors:

- **Please immediately forward this safety notice to any of your customers/end-users who have purchased these products with an urgent request that they read and comply with above instructions.**
- **Please check the date of manufacturing from December 2018 till December 2022 for the affected SKU mentioned in Table 1 below**
- Please ensure that your customers forward this safety information to their customers/ End users.

For questions or concerns, you can contact

Region	Phone Number	Email
Whole of Australia	+61 1300 139 166	<a href="mailto:HLSHSPAMelbourne@Honeywell.com">HLSHSPAMelbourne@Honeywell.com</a>
Western Australia	+61 89 337 6980	<a href="mailto:HLSHSPAPerth@Honeywell.com">HLSHSPAPerth@Honeywell.com</a>
New Zealand	+64 80 032 2200	<a href="mailto:HLSHSPNZ@Honeywell.com">HLSHSPNZ@Honeywell.com</a>

Or Ricky Gleis at his email: [Ricky.Gleis@honeywell.com](mailto:Ricky.Gleis@honeywell.com)

We expect your acknowledgment and RMA request within 3 months of the letter arriving to you, RMA will be issued once the affected product (with missing stitching) are being returned Honeywell.

We assure you that no other Honeywell Miller Fall Protection products are impacted, and they are safe to use. Honeywell has been a manufacturer of industrial personal protective safety products for more than 75 years and our customers' safety is ALWAYS our highest priority.

We sincerely apologize for any inconvenience that this situation may cause to you or your customers and thank you for your continued trust and longstanding business relationship with Honeywell.

Regards,

Honeywell Miller Fall Protection Team



**Table 1: Model numbers included in this Safety Notice**

L11KEC2.0	2m Kevlar Single Lanyard w/19mm hooks
L28KEC2.0	2M Kevlar Lanyard with 91326 TAKS
LA11KEC2.0	2m Kevlar Adjustable Lanyard w/19mm hook
LA28KEC2.0	2M Single Adjustable Kevlar Lanyard with
LD11KEC2.0	2m Kevlar Twin Lanyard w/19mm hooks
M1010058	2M Single Kevlar Lanyard with SS TAK
M1010119	2M Double Kevlar Web Lanyard TAK & Scaff
M1010118	2M SGL KEVLAR TAK & TA SCAFF
M1010067	Single Adj KMAX Lanyard Large Scaf & TASH
M1010068	Single Adj KMAX Lanyard Large Scaf & TAK
LD11KEC4.5	4.5M Twin Kmax w 19mm snaps